
FROST
DENMARK

SHOWER MIXER 1995-1

DESIGNED BY BØNNELYCKE MDD

PRODUCT DETAILS, TECHNICAL DETAILS
AND FITTING INSTRUCTIONS

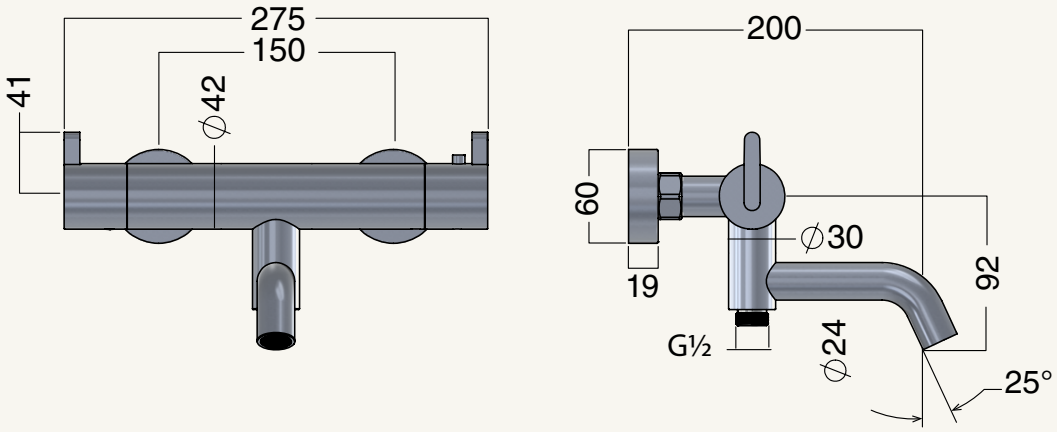

MATERIAL: STAINLESS STEEL


AVAILABLE IN THE NINE FROST FINISHES:

F1995-1	F1995-1-P	F1995-1-BOC	F1995-1-C	F1995-1-BMG	F1995-1-GO	F1995-1-BCB	F1995-1-B	F1995-1-W
BRUSHED STAINLESS	POLISHED STAINLESS	BRUSHED COPPER	POLISHED COPPER	BRUSHED GOLD	POLISHED GOLD	BRUSHED BLACK	MATT BLACK	MATT WHITE

BEFORE MOUNTING

1. Before installing, make sure the hot water valve is on the left and the cold is on the right. If that's not the case, contact a professional contractor.


2. Turn off the water supply before installation and remove any existing unit.

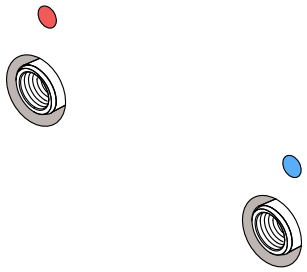

MOUNTING THE MIXER


3. Screw in the S-connections (A). Check their position when they protrude approximately 34 mm from the wall, the CC distance between the two S-connections must be 150 mm.

4. When in the right positions make markings, and then remove the connections.

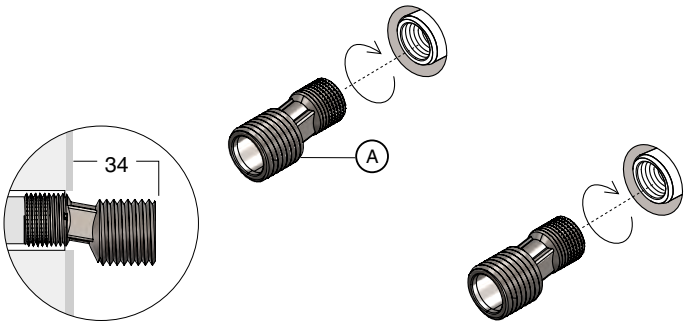

5. Seal them with plumbing hemp, and screw them back in with a spanner until the markings line up. Make sure not to mix up the left and right connections. Check the alignment with a spirit level.


6. Once the connections are fitted, fill the gap between the wall and the connections with a permanently elastic sealant.

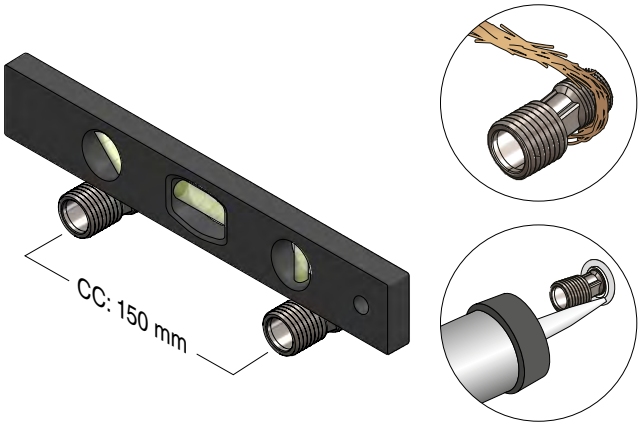

7. Screw the Cover Escutcheons (B) onto the S-connectors (A).


8. Remove the red and blue caps on the mixer and insert the two Filters (C) into the inlets of the thermostatic mixer as illustrated.

9. Mount the Mixer onto the connections using the two Union Nuts (D) as shown. Tighten with a spanner, but place a cloth between the spanner and the nuts to avoid damaging them.

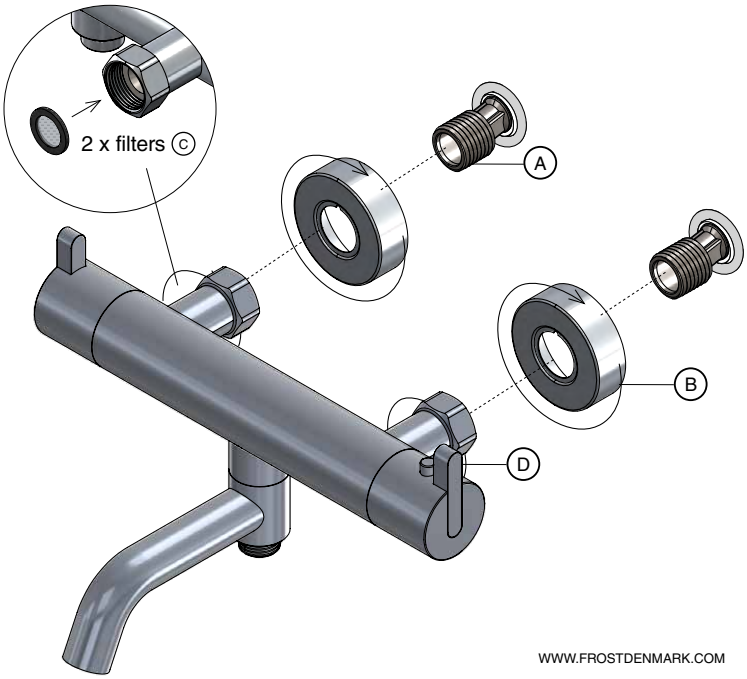


HOW TO USE

- To activate the Handheld Shower Head, turn the spout to the left or right, depending on the model.
- To turn on the Handheld Shower Head, turn the left Handle forward.
- To control the cold and warm water, use the right Handle by following the markings with + and -.

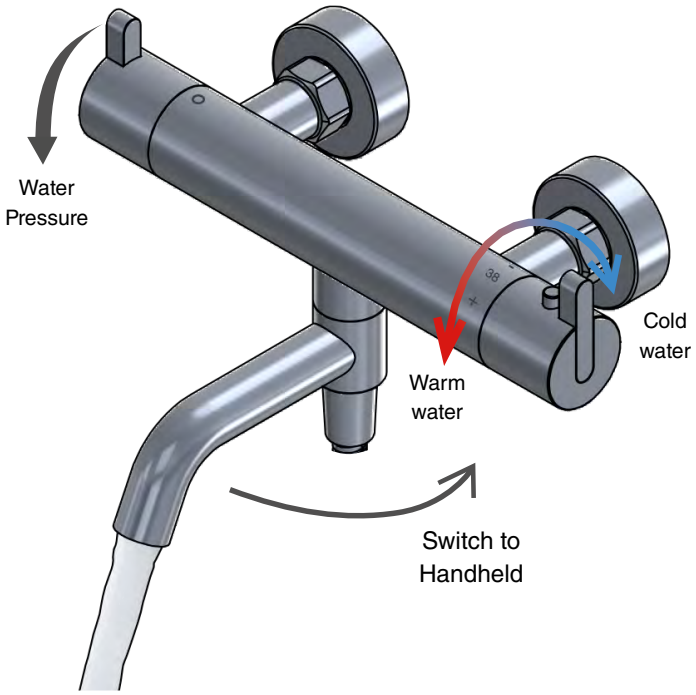

TECHNICAL INFORMATION

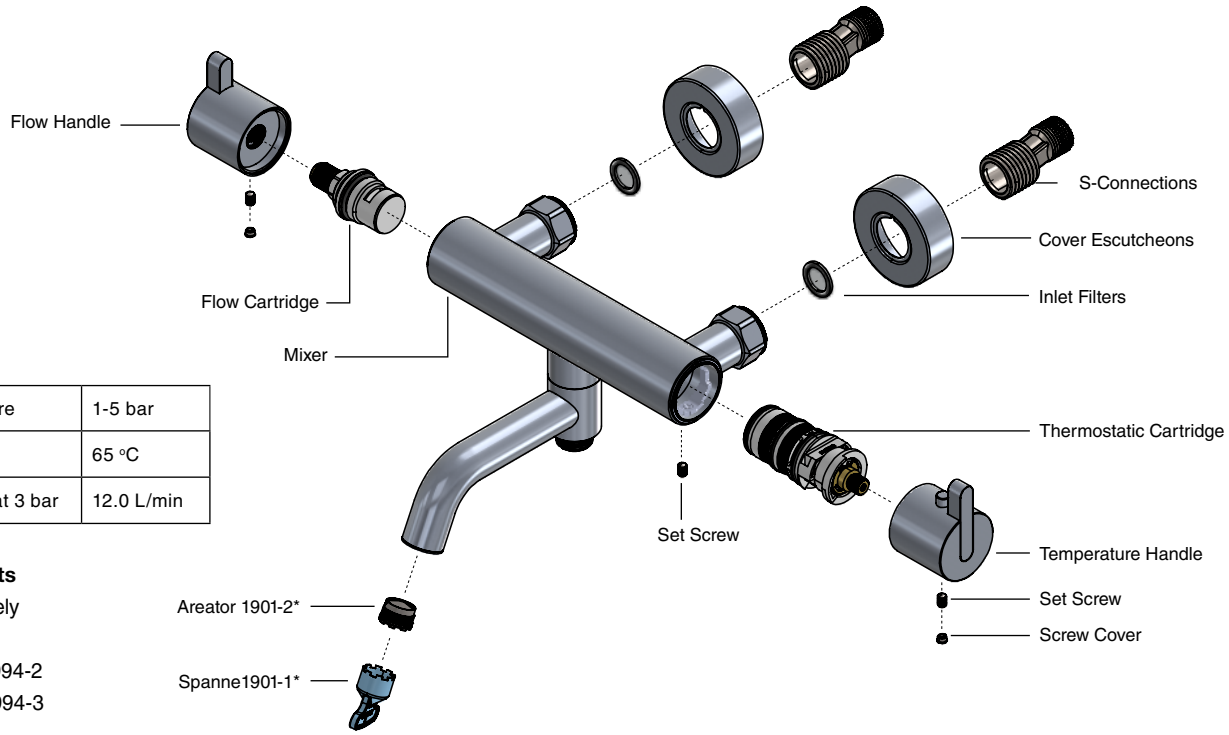

Working Pressure	1-5 bar
Max. hot water	65 °C
Flow rate l/min at 3 bar	12.0 L/min

Additional parts
Bought Separately

Shower Hose 1994-2
Shower Head 1994-3

CLEANING AND MAINTENANCE

Surfaces should be cleaned with a microfiber cloth, glass cleaner or other non abrasive and gentle agents.

ATTENTION:

Never use solvents or aggressive household cleaners like bleach, acids (e.g. descalers) or ammonia-based bathroom cleaner to clean the product. Steel wool and hard brushes can permanently damage the surface of the steel.

EXCLUSION OF LIABILITY

FROST accepts no liability whatsoever for damage to persons or property that occurs or has occurred as a result of improper installation or maintenance, particularly if the safety instructions and other points to note listed are not or have not been observed in full.

WARNING AND HAZARD NOTICES

Improper mounting or use can lead to accidents and serious injuries.

www.frostdenmark.com

Bavne Alle 32, 8370 Hadsten, Denmark

E-mail: info@frost.dk • Phone: (+45) 87 61 00 32

We are also to be found as frostdenmark on Facebook, Instagram, Pinterest and LinkedIn